



NS CONDITION REPORT


GENERAL INFO	
VEH NUMBER: NS210690	INSPECTOR: Matt B.
DATE: 2-10-19	WORK ORDER: 67377
ORIGINAL UPFITTER: Cherokee Truck	CHASSIS MANUF/MODEL: International 7400 SBA 6x4
SPEC TYPE: 129	CHASSIS VIN: 1HTWGAAARXB5325795
	MODEL YEAR: 01-2010
	MILEAGE: 108486
BODY MANUF/MODEL: Knapheide NS129HT	RAILGEAR MANUF/MODEL: DMF RW1630CF
BODY SERIAL NUMBER: 201609286183457	RAILGEAR SERIAL NUMBER: ser 29865 (F+) 1630CR 29866 (rear)
COMPRESSOR MANUF/MODEL:	WELDER MANUF/MODEL:
COMPRESSOR SERIAL NUMBER:	WELDER SERIAL NUMBER:
COMPRESSOR HOURS:	WELDER HOURS:
CRANE MANUF/MODEL: Palfinger PK12000	MISC MANUF/MODEL:
CRANE SERIAL NUMBER: 100116426	MISC SERIAL NUMBER:
CRANE REMOTE MANUF/MODEL: Hetric CS458TR	
CRANE REMOTE SERIAL NUMBER: EIA-4523 20710313386	
CRANE HOURS:	MISC HOURS:

Status: 1=Poor, 2=Fair, 3=Good, 4=Excellent

CHASSIS REPORT	STATUS	COMMENTS
BODY DAMAGE	3	Small dent pass door
RUST	3	
OPERABLE	(2) YES/NO	
AIR CONDITIONING	(PASS) FAIL	Works but feels like it needs some Freon
SEATS	3	
DASH	3	
DOOR PANEL	3	
LINER	3	
FLOOR	3	
GLASS	3	
ENGINE LEAKS	YES (NO)	IF YES EXPLAIN:
CHECK ENGINE LIGHT	YES (NO)	IF YES CODES:
ALIGNMENT	3	

BRAKING	3	
SUSPENSION	3	
TRANSMISSION	3	
ENGINE	3	
AXLES	3	
DRIVE TYPE	2WD/4WD	
DRIVE TYPE CONDITION	PASS/FAIL	
OTHER MECHANICAL		
TIRES	3	Use drawing below to mark tread depth for each tire and then fill in the overall rating to the left using the 1 to 4 scale
MISC COMMENTS		Front Bumper Ft Bumper Flexible Antennas Front Rail gear lights missing
Average Value		0.00
RECOMMENDATION		

Use the below drawing to fill out the Tire Tread depth for each tire using a scale from 1/32 to 15/32

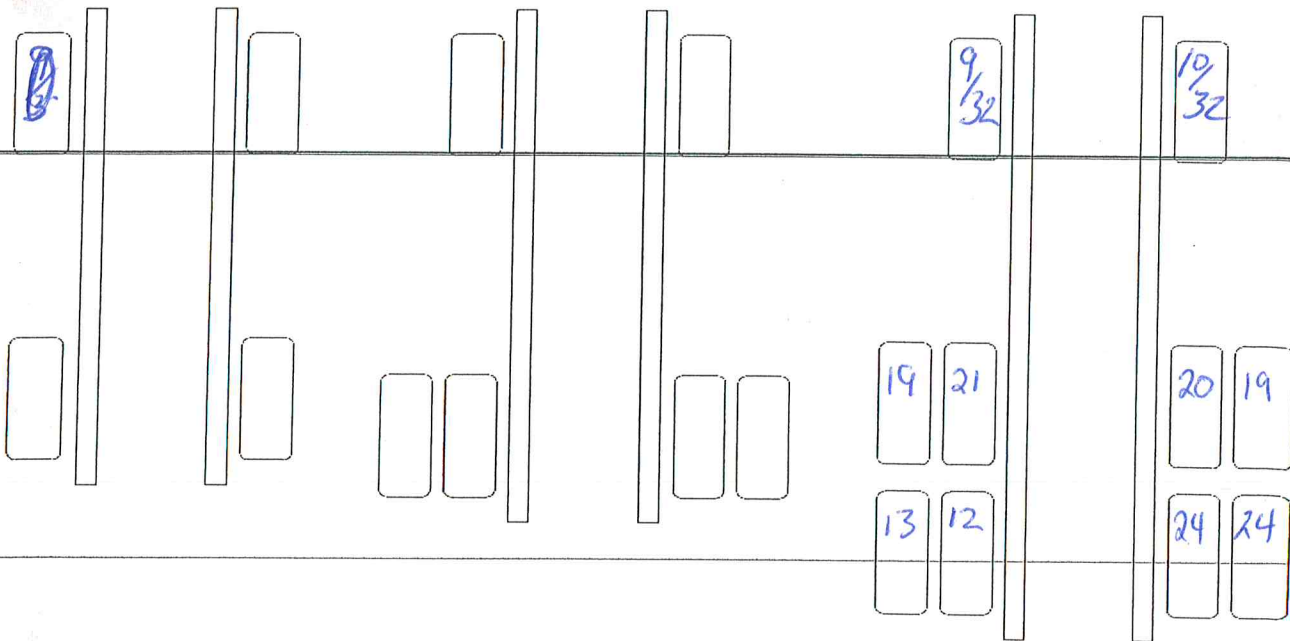

Status: 1=Poor, 2=Fair, 3= Good, 4=Excellent

BODY REPORT	STATUS	COMMENTS
DENTS	3	
RUST	2	Various small spots
DOORS	2	RF Door Catch missing spring + Not connected LF Lower Small Door missing latch interlocks
SHELVING	3	
PAINT	2	
MISC COMMENTS		Vise on Back Coming Apart Rear Bumper tray track Bent on Right. Doors on Rear bumper = 1 wont open, 2 wont shut on Hydraulics
Average Value		0.00
RECOMMENDATION		

Status: 1=Poor, 2=Fair, 3= Good, 4=Excellent

CRANE/AERIAL REPORT	STATUS	COMMENTS
OUTRIGGERS/STABILIZERS	3	Small leak on the Holding valves
HYDRAULIC LINES	3	
CABLES	NA	
BOOM SECTIONS	3	
HYDRAULIC VALVES	3	
PAINT	3	
THROTTLE CONTROLS	4	
START/STOP	4	
OPERATOR CONTROLS/STATION	2	Sticker Coming off of upper Panel (RR)
MOUNTING BOLTS	3	
ANTI TWO BLOCK/OVERLOAD PROTECTION	4	
ANGLE INDICATORS	N/A	
LOAD TEST	PASS/FAIL	IF FAIL EXPLAIN:
REMOTE	3	
STRUCTURAL CRACKS	3	
MISC COMMENTS		Sticker on Control (RR) of truck coming off
		Missing part of the Crane chart on rear bumper. (Flippable Cards)
Average Value	0.00	F
RECOMMENDATION		

Status: 1=Poor, 2=Fair, 3= Good, 4=Excellent

RAILGEAR REPORT	STATUS/WEAR	COMMENTS
WHEELS/BEARINGS		
Front Left	3	
Front Right	3	
Rear Left	3	
Rear Right	3	
VALVES	3	
HYDRAULIC LINES	3	
STRUCTURE/ARMS	3	
MISC COMMENTS		
Average Value	0.00	
RECOMMENDATION		

Status: 1=Poor, 2=Fair, 3= Good, 4=Excellent

COMPRESSOR REPORT	STATUS	COMMENTS
COVER		
PSI/CFM		

HYDRAULIC LINES		
AIR LEAKS		
MISCCOMMENTS		
Average Value	0.00	
RECOMMENDATION		

Status: 1=Poor, 2=Fair, 3= Good, 4=Excellent

WELDER REPORT	STATUS	COMMENTS
COVER		
ENGINE CONDITION		
OPERATIONAL	YES/NO	
GENERATOR-LOAD-TEST	PASS/FAIL	LOAD:
MISC COMMENTS		
Average Value	0.00	
RECOMMENDATION		

Status: 1=Poor, 2=Fair, 3= Good, 4=Excellent

MISC REPORT	STATUS	COMMENTS
MISC COMMENTS		

Status: 1=Poor, 2=Fair, 3= Good, 4=Excellent

OVERALL CONDITION	STATUS	COMMENTS
CHASIS/BODY OVERALL	0.00	

Note: Save Condition report as the vehicle number